
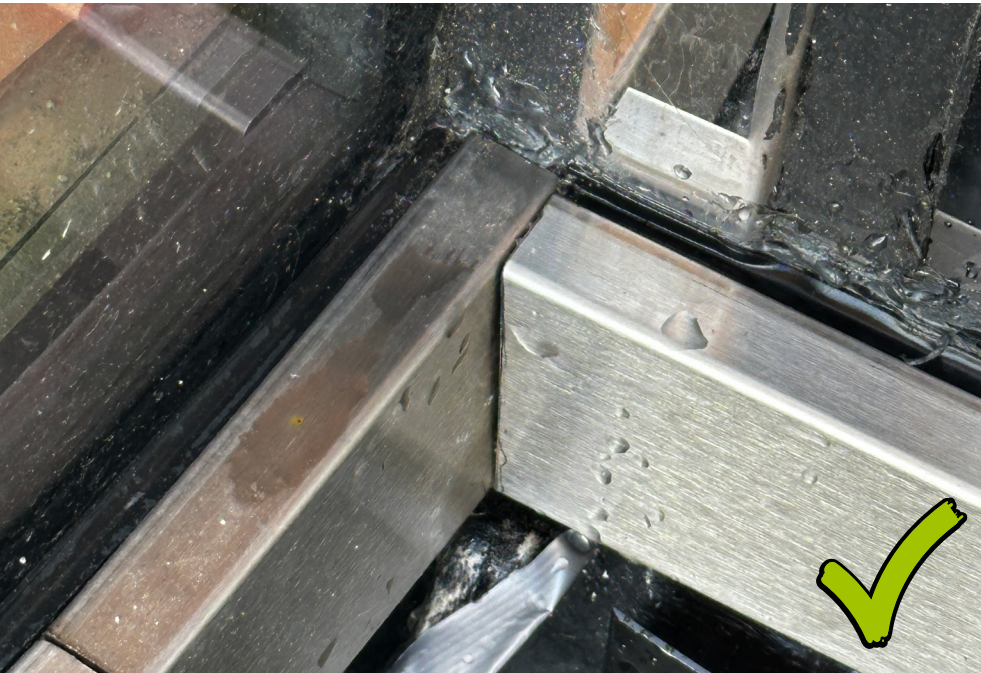
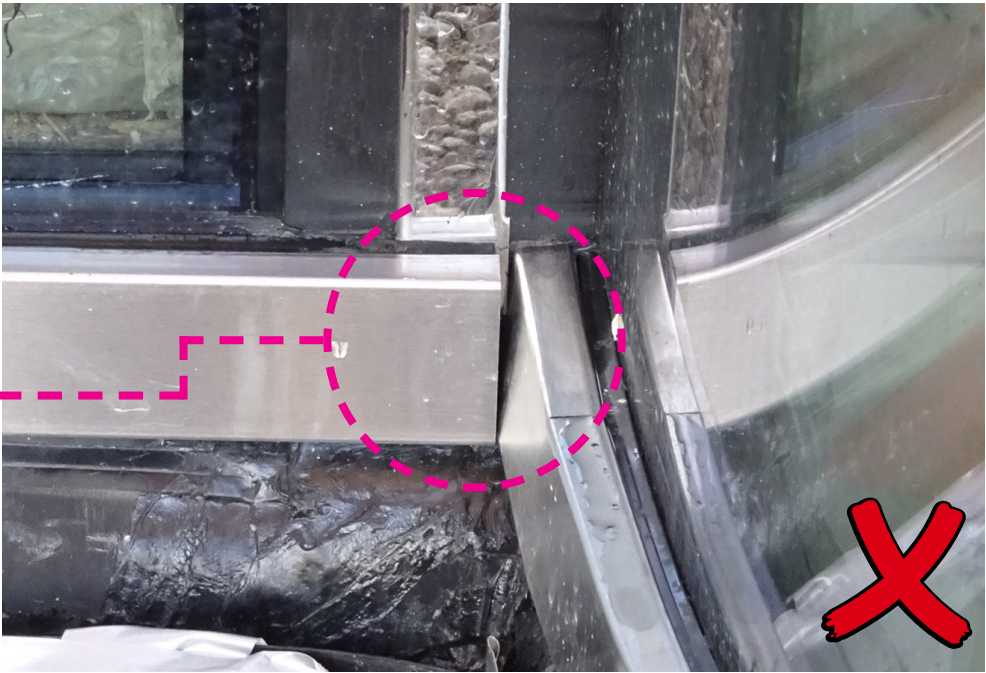



PRESSURE CAP ADJUSTMENTS

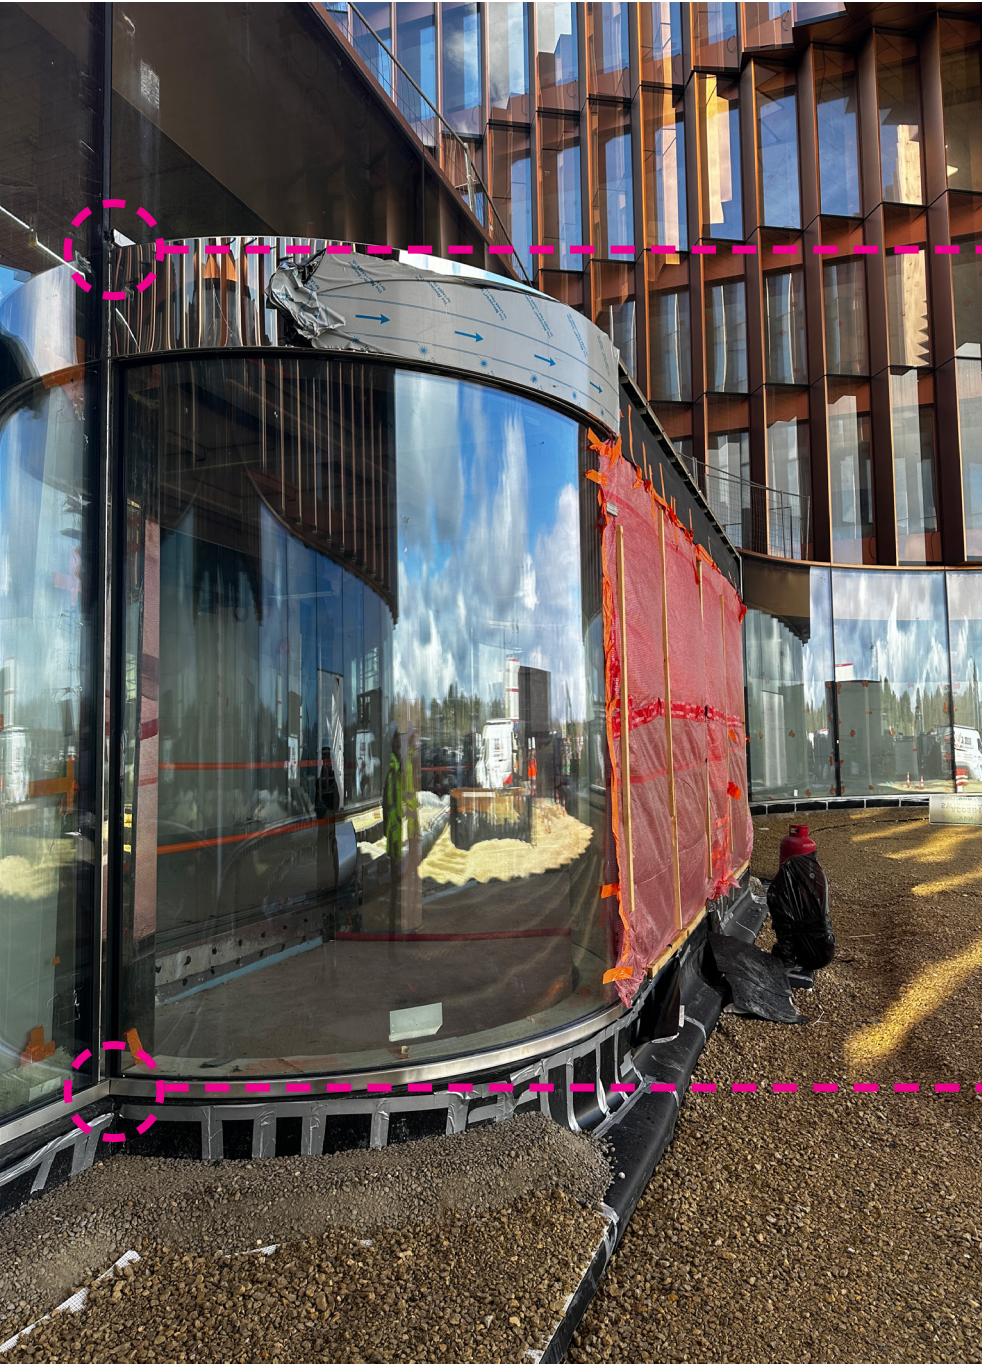

OBSERVATION:
- The pressure caps on the left side of the RDC airlock (top and bottom) are misaligned or broken, however; they are well executed on the right side.

RECOMMENDATION:
- Kyotec to adjust misalignments and replace damaged profiles.

VISIBLE SCREWS ON UNDERSIDE OF TOP PROFILE (INT.)

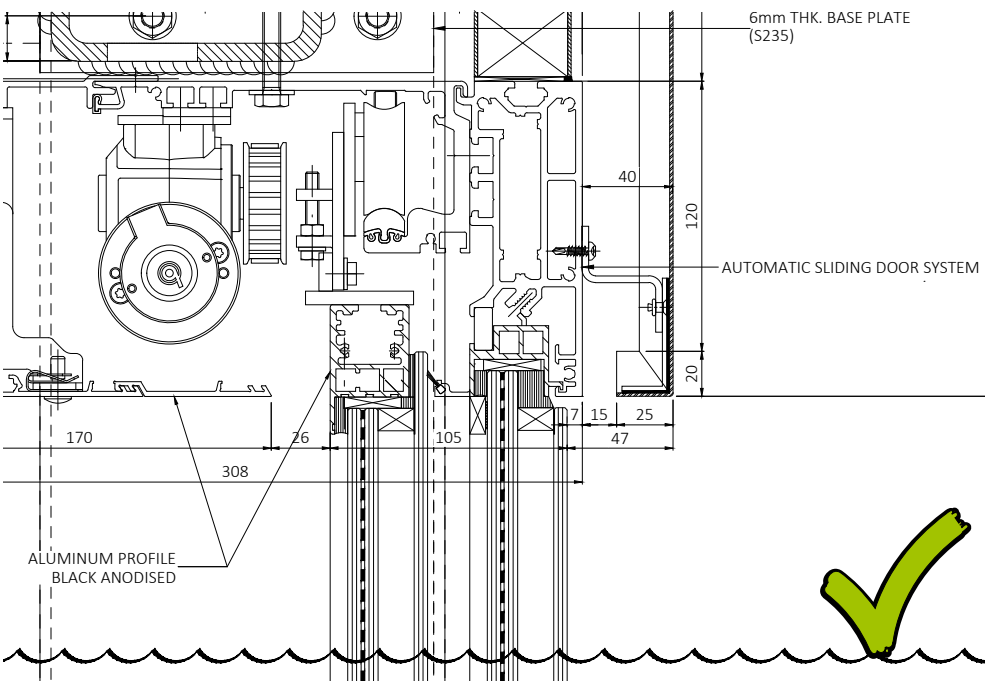

OBSERVATION:

- The upper panel on the interior side of the RDC airlock has screws visible on the underside. This was not executed as per the last approved detail by BIG, which has all fasteners concealed internally.

RECOMMENDATION:

- Kyotec to replace panels and execute the installation as per the last approved detail.


OVERALL EXECUTION



OBSERVATION:
- The overall appearance and details of the RDC airlock are well executed and the insertion and interface with the stick facade looks nice. Additionally, the appearance of the mirror finish is nice both internally and externally.

RECOMMENDATION:

PANEL EXECUTION: JOINTS OF EDGE PANEL / SOFFIT

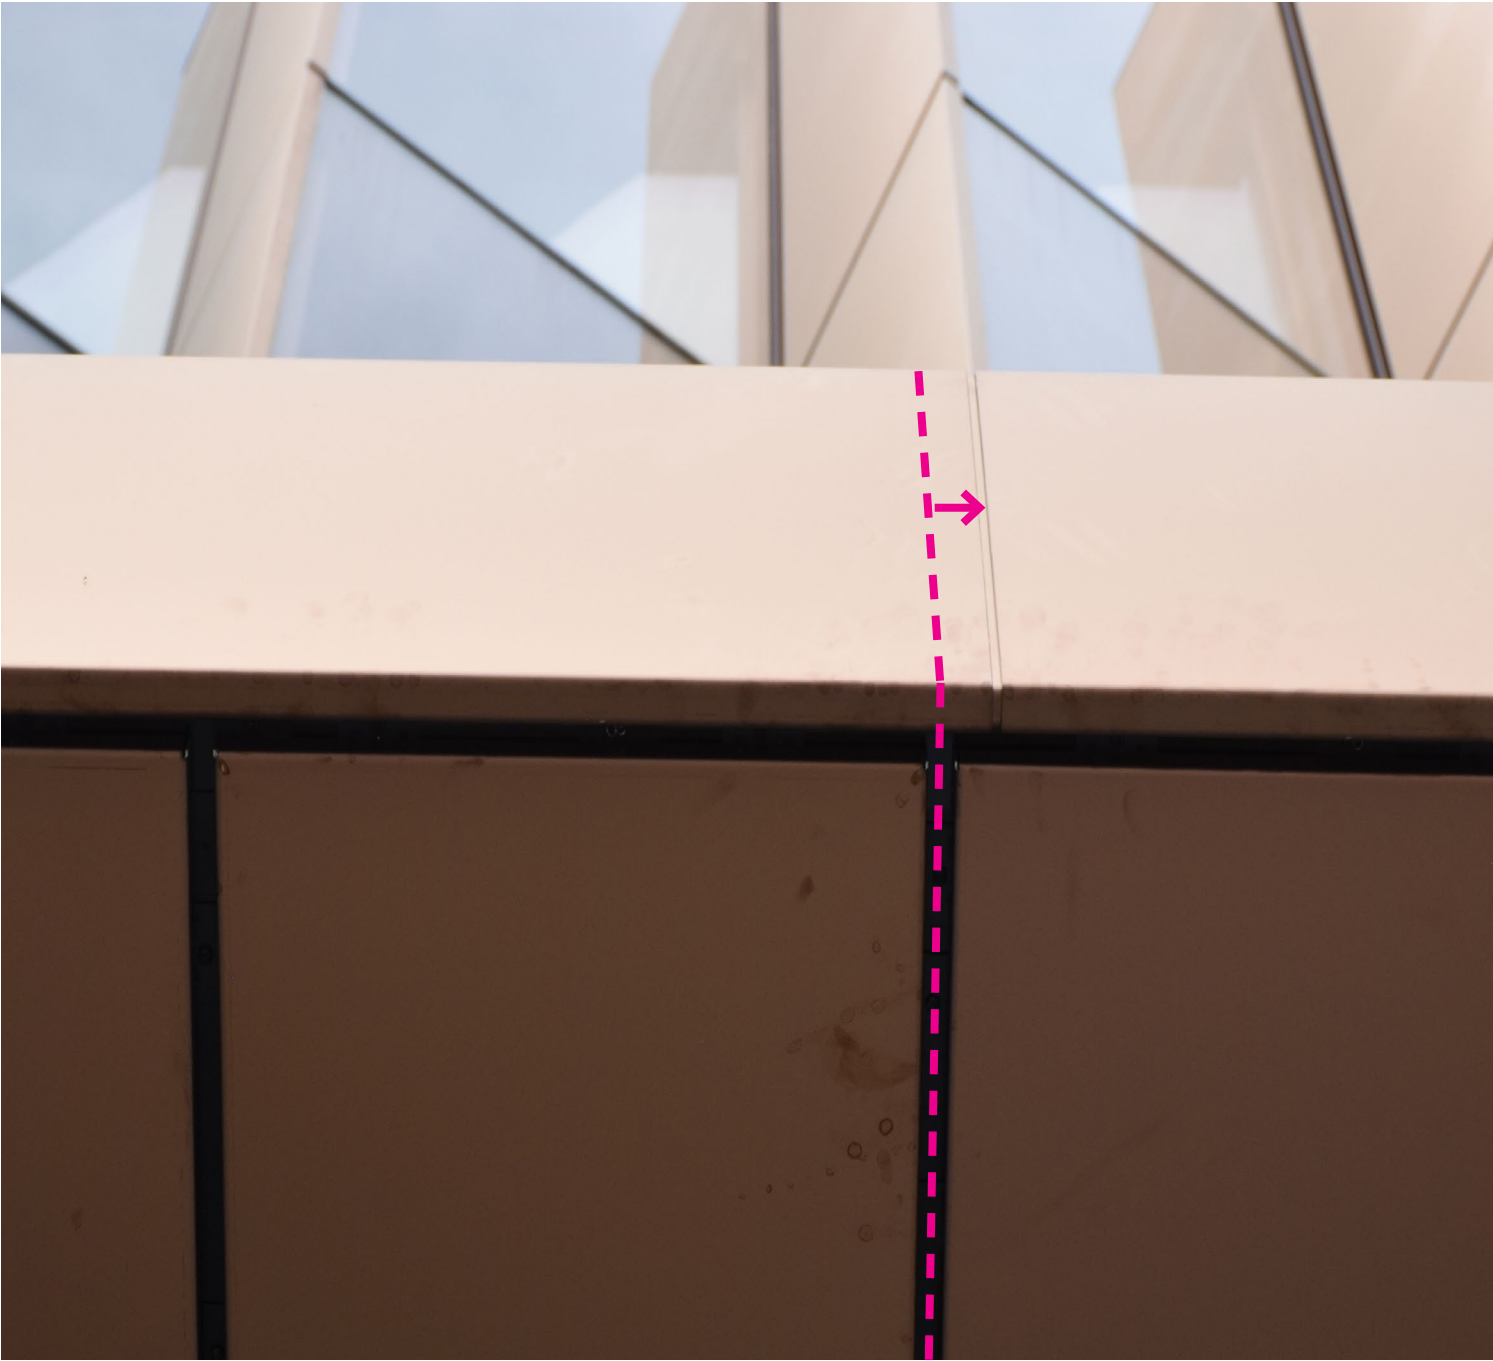

OBSERVATION:
- THE JOINTS BETWEEN THE EDGE PANELS AND THE SOFFIT ARE SLIGHTLY OFFSET AND MISALIGNED. THIS AGAIN SUPPORTS THE OBSERVATION THAT THE SOFFIT PANELS SHOULD BE SHIFTED TOWARD THE TERMINAL.


RECOMMENDATION:
- IF POSSIBLE, SHIFT THE SOFFIT PANELS TOWARDS THE TERMINAL. IF THE SHIFT IS NOT POSSIBLE, RE-CUT THE FRONT PANELS SO THAT THE JOINTS ARE ALIGNED WITH THOSE OF THE SOFFIT PANELS BELOW.

PANEL EXECUTION: GAP AT HOTEL SIDE




OBSERVATION:
- OVERALL EXECUTION HERE IS GREAT, HOWEVER; THE GAP ON THE BOTTOM SIDE LEAVES SOME OF THE SUBSTRUCTURE VISIBLE FROM BELOW.

RECOMMENDATION:
- INSTALL A SMALL FLASHING OR SOMETHING BLACK (VERTICALLY ON TO THE STRUCTURE) TO MINIMIZE THE VISIBILITY OF THE GALVANIZED STRUCTURE.

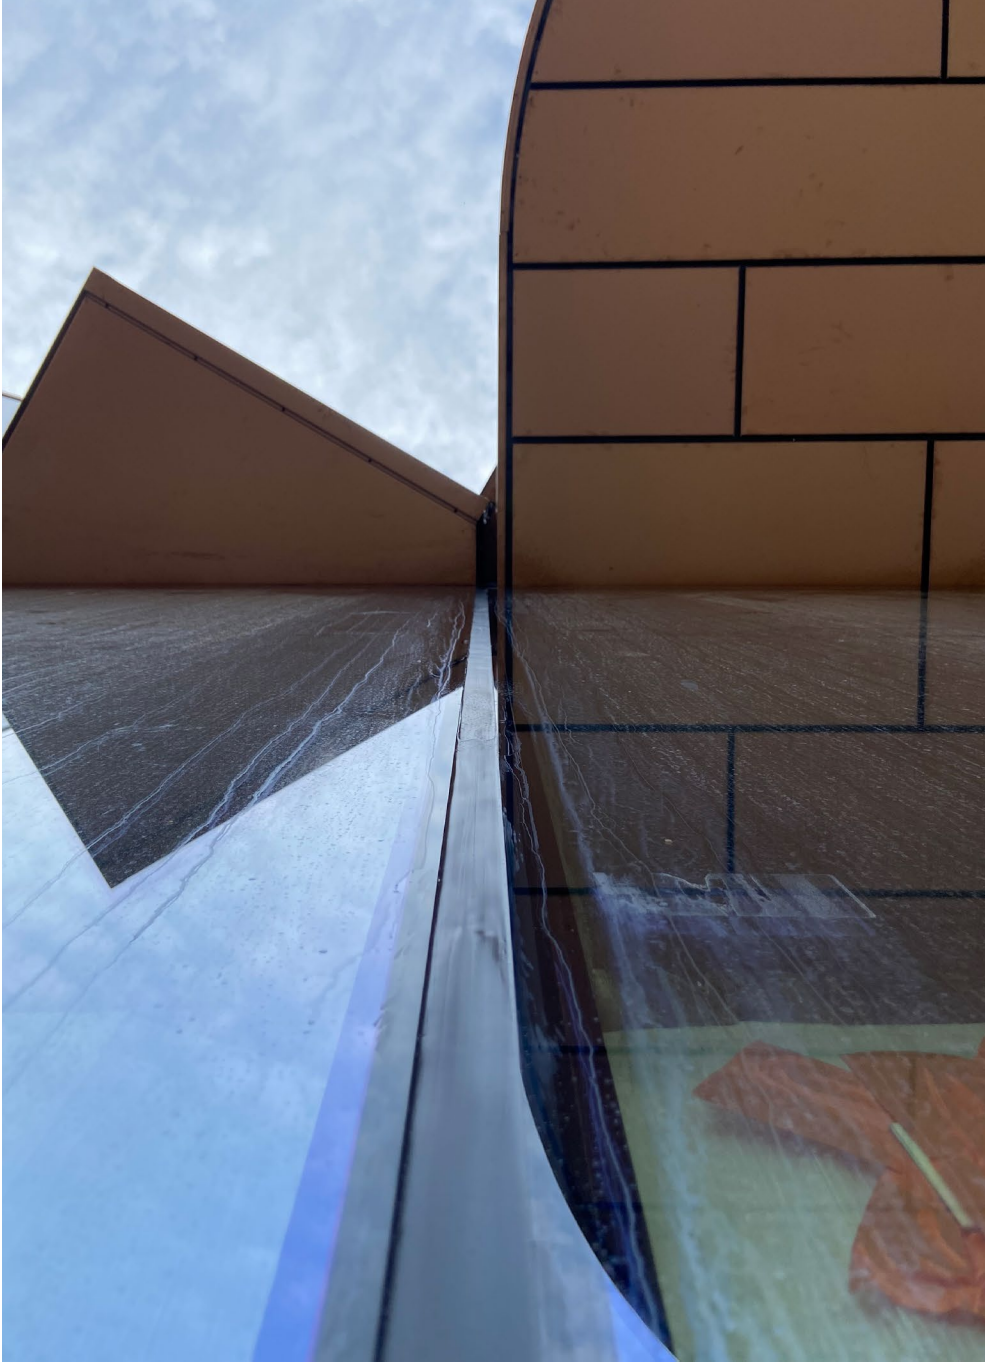

THE SUBSTRUCTURE SHOULD BE CONCEALED HERE.

PANEL EXECUTION: SECOND JOINT AT CURVE

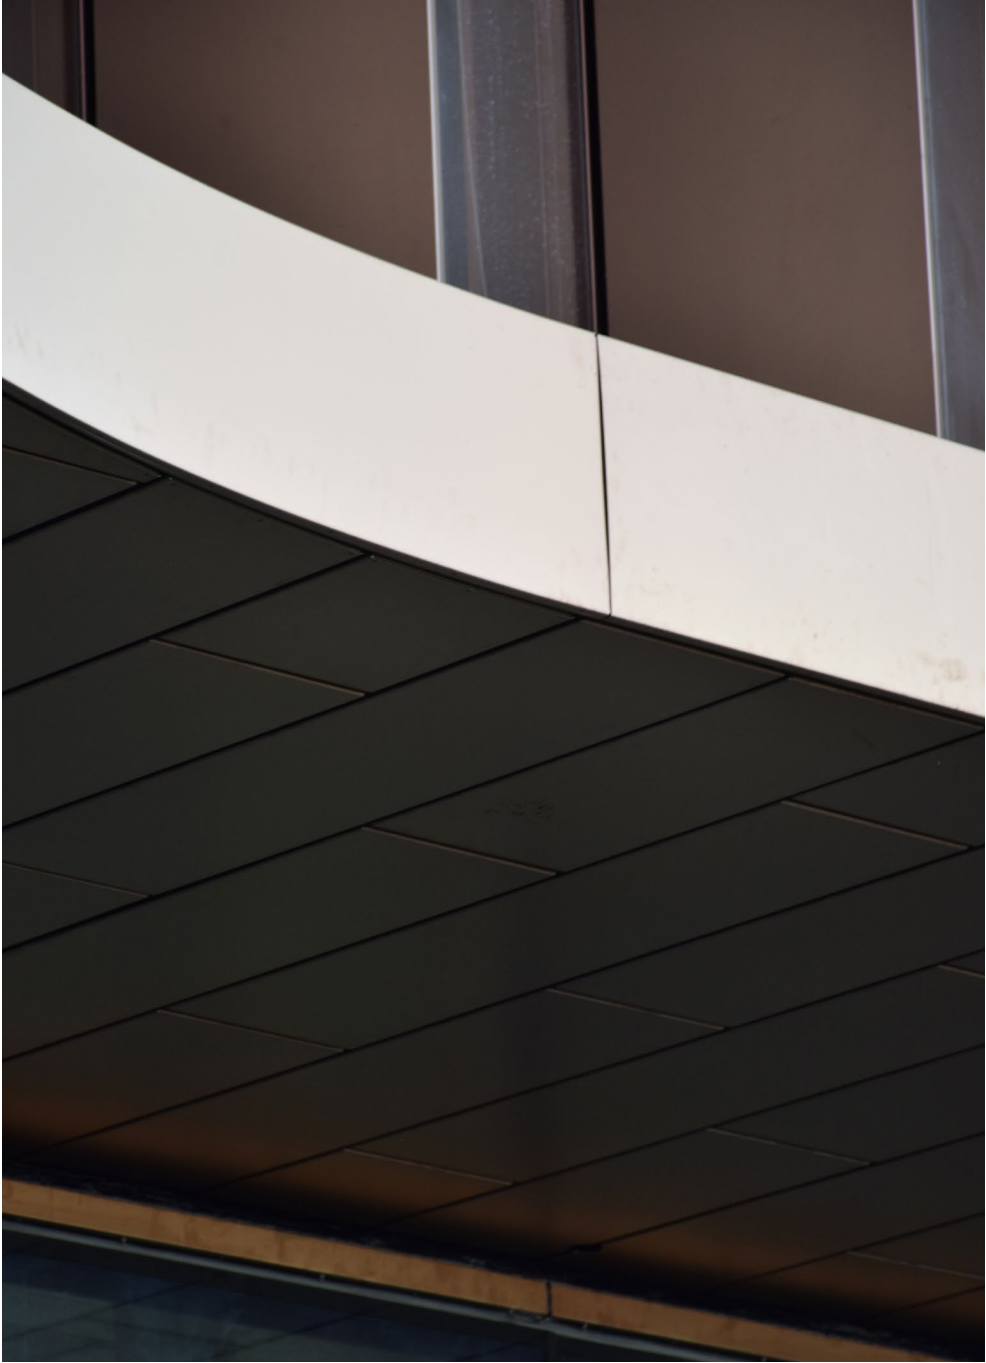

OBSERVATION:
- THE APPEARANCE OF THIS JOINT IS UNSATISFACTORY AND THE PANEL SEEMS TO BE DENTED OR WARPED, CREATING A GAP.

RECOMMENDATION:
- REPLACE OR ADJUST PANELS.